

Manhole Inspection Summary

Manhole # S07II_006MH

Printed On: 6/24/2010

Page 1 of 4

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **07II** Node: **006** Status: **Found**

Insp Date: **3/13/08 2:45 PM**

Incomplete Comments

Crew: **RL SD**
Inspector: **Lamont**
Firm: **URS**

Location Address: **1805 CHELSEA RD**

Cross Street: **ROW PAST BACK YARD**

Manhole Type: **Inline** Location: **Easement / Right of Way**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **32** (in.) Length: (in.) Dist A/B Grade: **2** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☐ Exists Material: ☐ Parged Height: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☒ **Roots** ☐ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris


Steps Count: **4** Missing: **0** ☐ Corroded

Surcharge ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Location View



Top View

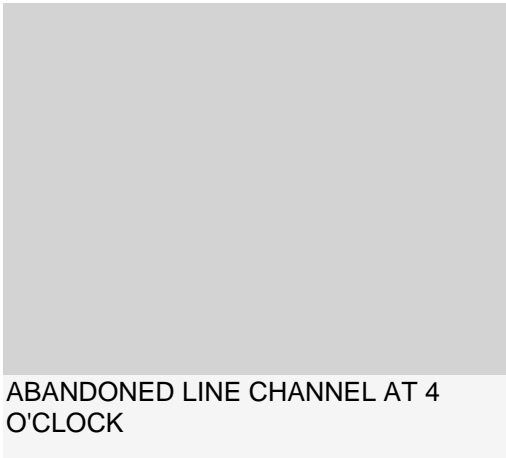


Top View



CLOSED OFF PIPE AT 5 OCLOCK



Defect 1

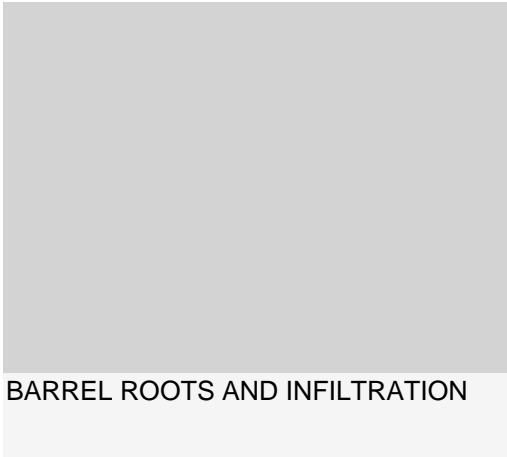

Manhole Inspection Summary

Manhole # S07II_006MH

Printed On: 6/24/2010

Page 3 of 4

24 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



Pipe Height: **24** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.40** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ **Debris** ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

24 in. Circular Gravity Sewer
Pipe In @ 5 O'Clock

5 O'Clock Inflow



CEMENTED OFF PIPE AT 5 OCLOCK

Pipe Height: **24** (in.) Rod and Bar (Angled)

Pipe Material: **Concrete** ☐ Pipe Lined

Invert Depth: **8.10** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ **Debris** ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Stub connection / abandoned**

☐ Possible Illicit Connection

Manhole Inspection Summary

Manhole # S07II_006MH

Printed On: 6/24/2010

Page 4 of 4

15 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



PIPE DEBRIS

Pipe Height: **15.6** (in.) Rod and Bar (Angled)

Pipe Material: **Clay** ☒ Pipe Lined

Invert Depth: **8.20** (ft.) Flow Characteristics: **Fast**

Deposits: ☐ None ☐ Mud ☐ Sludge ☒ **Debris** ☐ Grease

Silt Depth: **2** (in.) Deposits Extent: **Medium**

Infiltration: **None** Pipe Seal Cond: **Sound**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection